



SERVIÇO PÚBLICO FEDERAL
DEPARTAMENTO DE AVIAÇÃO CIVIL

BRAZILIAN AIRWORTHINESS DIRECTIVE

EFFECTIVE DATE:

08 Dec. 2005

AD No.:

2005-11-01

The following Airworthiness Directive (AD), issued by the Departamento de Aviação Civil (DAC) in accordance with provisions of Chapter IV, Title III of Código Brasileiro de Aeronáutica - Law No. 7,565 dated 19 December 1986 - and Regulamento Brasileiro de Homologação Aeronáutica (RBHA) 39, applies to all aircraft registered in the Registro Aeronáutico Brasileiro. No person may operate an aircraft to which this AD applies, unless it has previously complied with the requirements established herein.

AD No. 2005-11-01 - EMBRAER - Amendment 39-1103.

APPLICABILITY:

This Airworthiness Directive is applicable to all Embraer ERJ-170() aircraft models in operation.

CANCELLATION / REVISION:

Not applicable.

REASON:

It has been found cases where the lavatory waste compartment doors mini-latches lost their strength over time, resulting in door opening in flight due to waste bin movement during takeoff. This led to a failure of the door to comply with the requirement of fire containment, risking the safety of the airplane in case of fire inside the lavatory waste compartment.

Since this condition may occur in other airplanes of the same type and affects flight safety, a corrective action is required. Thus, sufficient reason exists to request compliance with this AD in the indicated time limit.

REQUIRED ACTION:

Replacement of the lavatories waste compartment door latches.

COMPLIANCE:

Required as indicated below, unless already accomplished.

Within the next 700 flight hours after the effective date of this AD, replace the forward lavatory waste compartment door mini-latch P/N FE944WH, and striker P/N 170-91328-001, with mini-latch P/N CDSP1017-501 and striker P/N 170-91328-003; and the aft lavatory amenity door mini-latch P/N FE944WH, and striker P/N 170-43929-001, with mini-latch P/N CDSP1017-501 and striker P/N 170-43929-003.

The detailed instructions and procedures to accomplish this AD are described in the Embraer Service Bulletin No. 170-25-0024, original issue, or further revisions approved by the CTA.

Record compliance with this AD in the applicable maintenance log book.

CONTACT:

For additional technical information, contact:

Centro Técnico Aeroespacial - CTA
Instituto de Fomento e Coordenação Industrial - IFI
Divisão de Certificação de Aviação Civil - CAVC
Praça Mal. Eduardo Gomes, 50 - Vila das Acácias
Caixa Postal 6001
Fax: 55 (12) 3941-4766
12231-970 - São José dos Campos - SP, BRAZIL.
e-mail: pds@ifi.cta.br

For acquisition, contact:

Departamento de Aviação Civil - DAC
Seção de Publicações do DAC (4GAB-4)
R. Santa Luzia, 651, 2º Mezanino, Centro
Fax: 55 (21) 3814-6929
20030-040 - Rio de Janeiro - RJ, BRAZIL.
e-mail: publicacoes@dac.gov.br

APPROVAL:

GERALDO CURCIO NETO Ten Cel Av
Chief of the Civil Aviation Certification Division
IFI/CTA

LUIZ ALBERTO C. MUNARETTO Cel Av
Director of the Industrial Coordination and Fostering Institute
CTA

NOTE: Original in Portuguese language signed and available in the files of the Registro Geral de Aeronavegabilidade (RGA/TE-1/STE) of the Departamento de Aviação Civil.